


V-9

CORNER RESTORATION

CORNER: Corner common to Sections 28, 29, 32 & 33, T1N, R23E, W.M.

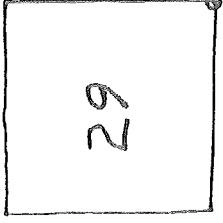

ORIGINAL SURVEY BY: David P. Thompson


CONTRACT NUMBER: 119

CONTRACT DATE: February 15, 1867

ORIGINAL DESCRIPTION: Set charred stake. No bearing objects.

RESTORATION BY, STAMP, AND DATE:

Benjamin B. Beseda, PLS 50800
 Field Work completed January 13, 2012
 Field Crew Bradley R. Huffmon, PLS 2786, Crew Chief
 And Rob Walker, Survey Tech.

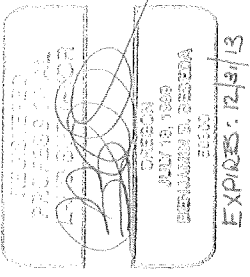

EVIDENCE FOUND:

Corner position falls at the intersection of ancient fence remnants running north, west and east from this location. Fence corner is still intact. The land is sandy and rolling and has been subject to cultivation to the southeast. No evidence of the original corner was found. A survey for Four Mile Land Co. by Edwards Surveying filed September 2005, C. S. No. 1440 - C, accepted an ancient 4 way fence intersection but set no monument.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

With no traces of the original monument found, the corner position was calculated per C. S. No. 1440-C which falls at the intersection of the ancient fence remnants running to the north, west and east from this location.

Set 5/8" x .30" rebar with 2-1/2" diameter stamped aluminum cap, at section corner position.
 Monument is set flush with the ground.

5/8" rebar with yellow plastic cap stamped "B BESEDA PLS 50800" flush with the ground bear as references as follows from the section corner:

- 1) North 47° 22' 28" East 45.11'
- 2) South 56° 30' 09" East 28.30'
- 3) South 63° 34' 50" West 47.97'
- 4) North 49° 03' 55" West 49.07'