

OREGON CORNER RESTORATION FORM

SECTION: 30 TOWNSHIP: 5N RANGE: 27E R-1

COUNTY: MORROW DATE: 5/06

CORNER DESIGNATION
NW Section 30
___ **CONDITION REPORT ONLY**
___ **NOT FOUND**
___ **RENEWED**
___ **UNRECORDED**
 SURVEYED IN
 REFERENCED OUT

PREVIOUS RENEWALS/SURVEYS ETC.

Originally surveyed by Davenport under Contract # 101 in 1861. He set post and made mound. In a 1915 GLO survey Ganong set a 2 1/2 inch brass cap.

In 1987 Krumbain found 2 1/2" brass cap & set a 1"x30" iron pipe with 2 3/8" brass cap over it.

MONUMENTS AND ACCESSORIES FOUND: CONDITION AND SOURCE

Nothing found. All monuments obliterated by recent sanitary sewer construction.

MONUMENT DETAIL

T5N
R26E S24 | S19 R27E
S25 | S30
2006
LS 951

MONUMENT SET (PROCEDURES AND DESCRIPTION)

By retracing my 1979 survey for Irish in Section 30, I set a 5/8" by 30" iron rebar with a 2" alum. cap stamped as above flush with the surface of a paved road.

NEW ACCESSORIES FROM WHICH

A 5/8" x 30" Iron Rebar with plastic cap #951 bears N 35° 05' 15" W 51.43'
A 5/8" x 30" Iron Rebar with plastic cap #951 bears S 10° 02' 15" E 178.89'
A 1/2" x 24" Iron Rebar bears S 45° 02' 44" E 42.68'
The top center nut of a fire hydrant bears S 51° 47' 21" W 42.43'

LOCATION AND COMMENTS

At the intersection of Division Street & Idaho Avenue.

SURVEYOR'S SEAL

**FIRM: EDWARDS SURVEYING LLC
PO BOX 763 - HERMISTON OR 97838**

**PARTY CHIEF: R. SMITH
WITNESS: J. JOSEPH**



G. Dennis Edwards

