


CORNER RESTORATION

CORNER: Corner common to Sections 21, 22, 27 & 28,
T2N, R23E, W.M.

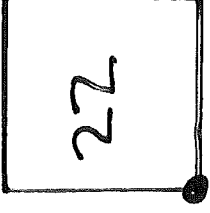

ORIGINAL SURVEY BY: B.J. Pengra

CONTRACT NUMBER: 119

CONTRACT DATE: February 15, 1867

ORIGINAL DESCRIPTION: Set post in mound of earth with charred stake pits. No bearing objects.

RESTORATION BY, STAMP, AND DATE:

Benjamin B. Beseda, PLS 50800
Field Work completed January 5, 2012
Field Crew Bradley R. Huffmon, PLS 2786
And Rob Walker, Survey Tech

**EVIDENCE FOUND:**

Corner position falls at the intersection of ancient fences running north, east and west from the corner location. Surrounding land does not appear to have been subject to past cultivation. No evidence of the original corner was found.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

With no traces of the original monument found, the corner position was accepted to be the intersection of the ancient fences running north, east and west from the corner location.

Set 5/8"x 30" rebar with 2-1/2" diameter stamped aluminum cap at section corner position.
Monument is set flush with the ground.

Set 5/8" rebar with yellow plastic cap stamped "B BESEDA PLS #50800" as references as follows from the section corner:

1. North 36°42'54" East 54.12 feet.
2. South 49°13'58" East 31.79 feet.
3. South 46°28'22" West 58.56 feet.
4. North 43°55'35" West 60.00 feet.

All references are set flush with ground surface.

