


CORNER RESTORATION

CORNER: Corner common to Sections 33 & 34, T2N, R23E and Sections 3 & 4, T1N, R23E, W.M.

ORIGINAL SURVEY BY: David P. Thompson

CONTRACT NUMBER: 119

CONTRACT DATE: February 15, 1867

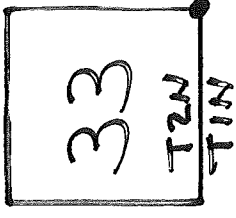

ORIGINAL DESCRIPTION: Set stone 18 x 12 x 4. No bearing objects.

RESTORATION BY, STAMP, AND DATE:

Benjamin B. Beseda, PLS 50800
Field Work completed June 24, 2011
Field Crew: Kelly McCargar, PLS 60179

**EVIDENCE FOUND:**

Corner position falls at the intersection of ancient fences running north and east from this location. There is a newer east-west fence that was rebuilt 15 feet south of this position. No evidence of the original corner was found.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

With no traces of the original monument found, the corner position was accepted to be at the intersection of the ancient fences running north and east from this location.

Set 5/8" x 30" rebar with 2-1/2" diameter stamped aluminum cap, at the 1/4 corner position.
Monument is set 0.1 feet +/- out of ground.

The following references being 5/8" x 30" rebar with yellow plastic cap stamped "B BESEDA PLS #50800" were set flush with natural ground and bear as follows from the section corner, unless otherwise noted.

1. North 60°55'58" East 17.82 feet.
2. South 75°25'26" East 39.79 feet.
3. South 30°35'21" East 19.39 feet.
4. South 42°23'10" West 23.26 feet.

