

# OREGON CORNER RESTORATION FORM

COUNTY: Morrow. DATE: 03/28/17.

CORNER DESIGNATION: J-25, The Northeast corner of Section 13, Township 3 North, Range 26 East, W.M..

PREVIOUS RENEWALS/SURVEYS ETC: Corner originally established by E. E. Haft, under Contract No. 93 dated September 11, 1860. Notes state: Set post for corner to secs. 12, 13, 7 & 18 in mound with trench and pits and deposited 1 pint of charcoal as per instructions. Corner was reestablished by proportionate measure by Otis Gould, GLO Surveyor, in 1939. Gould's notes state: Set an iron post, 3 ft. long, 2 in. Diam., 27 ins. in the ground, for cor. of secs. 7, 12, 13, and 18, with brass cap, dug pits 18x18x12 ins., in each sec., 3 ft. dist. This corner was recovered and tied by survey by Rogers Surveying in 1973, as shown on Survey No. 1759.

MONUMENT AND ACCESSORIES FOUND: No corner monument found. The corner monument has been destroyed by irrigation canal construction. I reestablish the position of this corner using the compass rule method between the recovered Southwest corner of Section 18 and the recovered East one-quarter corner of Section 12 using Rogers Surveying Survey No. 1759 record.

## MONUMENT MARKING DETAIL:

T3N  
R26E|R27E  
S12	S7
S13|S18  
2017  
PLS 1106

MONUMENT SET: Set a 2 3/8" diameter brass cap on a 1 1/4"x30" galvanized iron pipe, 28" in the ground, marked as shown in "Monument Marking Detail".

New accessories:

- A 5/8" by 24" rebar with red plastic cap bears N 47°45' E, 30.1'.
  - A 5/8" by 24" rebar with red plastic cap bears S 42°57' E, 27.7'.
  - A 5/8" by 24" rebar with red plastic cap bears S 54°52' W, 32.7'.
  - A 5/8" by 24" rebar with red plastic cap bears N 40°41' W, 25.9'.
- Assessory bearings are Oregon State Plane grid.

The red plastic caps are marked "ORPLS 1106 WAPLS 17372". All rebar accessories have "bearing object" signs wired to them. Wired a "Witness" sign to steel fence post set 3' North of the corner monument.

LOCATION AND COMMENTS: Corner is located just South of the top of an irrigation canal berm on the South side of a concrete lined irrigation canal.


OREGON STATE PLANE COORDINATE, North Zone, NAD 83(2011), epoch 2010:

N = 760401.47  
E = 8457902.66


FIRM: Wells Surveying  
P.O. Box 1696  
Pendleton, OR 97801

Surveyor's Seal

RECEIVED BY  
Morrow County Surveyor  
Date: 4-11-2017  
Rec'd By: S.K.H.  
No.: 2017-17980C  
Folder No.: 3N26J25

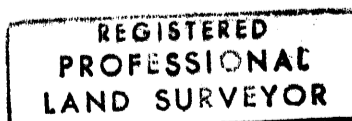

*William R. Wells*



*renews 6-30-18*