

OREGON CORNER RESTORATION FORM

SECTION 30 TOWNSHIP 4 N RANGE 27 E T-1

COUNTY : MORROW DATE 9/2005

CORNER DESIGNATION

W 1/4 COR.

— CONDITION REPORT ONLY
— NOT FOUND
 RENEWED
— UNCOVERED
— SURVEYED IN
 REFERENCED

PREVIOUS RENEWALS / SURVEYS, ETC.


ORIGINAL SURVEYS CONTRACT #93 IN 1860, #131 IN 1870, & #209 IN 1874.
INDEPENDENT SURVEY BY GOULD IN 1939. HE SET 1" IRON PIPE WITH 2 1/2" BRASS CAP.

MONUMENTS AND ACCESSORIES FOUND: CONDITION AND SOURCE


GOULD'S IRON PIPE BADLY BENT



SKETCH

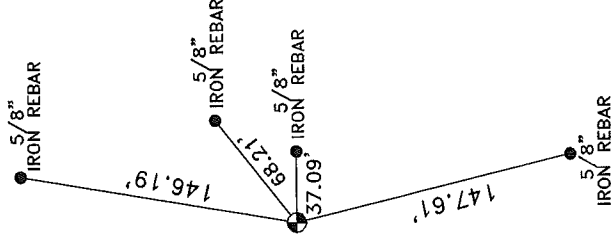

MONUMENT DETAIL

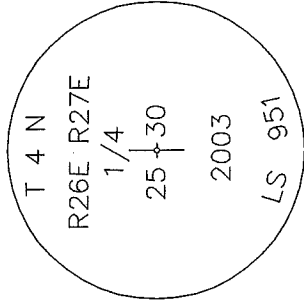

MONUMENT SET (PROCEDURES AND DESCRIPTION)

REPLACED GOULD'S PIPE WITH A 1"X30" IRON PIPE WITH A 2 3/8" BRASS CAP
STAMPED AS ABOVE.

NEW ACCESSORIES FROM WHICH

- A 5/8"X30" IRON REBAR WITH PLASTIC CAP #951 BEARS S 13°39'30"E 147.61 FEET.
- A 5/8"X30" IRON REBAR WITH PLASTIC CAP #951 BEARS N 89°36'04" E 37.09 FEET.
- A 5/8"X30" IRON REBAR WITH PLASTIC CAP #951 BEARS N 9°41'46" E 146.19 FEET.
- A 5/8"X30" IRON REBAR WITH PLASTIC CAP #951 BEARS N 51°36'53" E 68.21 FEET.

LOCATION AND COMMENTS

FROM THE UMATILLA ARMY
ORDINANCE INTERCHANGE OF I-84
GO WEST ON THE FRONTAGE
ROAD SOUTH OF FREEWAY 4 MILES
TO A PROPERTY LINE. GO SOUTH
ALONG PROPERTY LINE 0.9 MILES
TO CORNER.

COMPASS DEC.

FIRM/AGENCY
EDWARDS SURVEYING
P.O. BOX 763
HERMISTON, OREGON 97838

PARTY CHIEF
CURTIS FAVOREL

NOTES

WITNESS
RICK SMITH

SURVEYOR'S SEAL

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 16, 1971
G. DENNIS EDWARDS
9 5 1

RENEWS 12/31/2005