

**OREGON CORNER RESTORATION FORM**

COUNTY: Morrow DATE: 08/31/01

CORNER DESIGNATION: E-5

PREVIOUS RENEWALS/SURVEYS ETC.: Corner was originally surveyed by Edward W. Sanderson under Contract No. 417, dated August 24, 1881. Original notes state: At point 50 ft. below summit of butte, set basalt stone 12 x 10 x 8 ins 8 ins in ground for Cor. to Secs. 5, 6, 7 & 8, marked with 5 notches on S. and E. edges. Raised mound of stone alongside.

MONUMENT AND ACCESSORIES FOUND: Found a 12" x 10" x 8" basalt stone with 5 notches on one side only, lying sideways in a depression in the ground.

MONUMENT MARKING DETAIL:

T4S R29E  
S6 | S5  
S7 | S8  
2001  
PLS 1106

MONUMENT SET: At position of found original stone, set a 2 1/2" aluminum cap on a 2 1/2" x 30" aluminum pipe, 20" in the ground, with top 10" above ground level. Made a 3 foot mound of stone around new monument. Original stone is in mound of stone, notched marks, N 60° W, 0.30 feet from monument.

Bearing trees:


- An 18" ponderosa pine bears N 57°10' E, 80.6 feet, scribed T4S R29E S5 BT.
- A 10" ponderosa pine bears S 63°46' E, 107.3 feet, scribed T4S R29E S8 BT.
- A 16" white fir bears S 71°17' W, 120.9 feet, scribed T4S R29E S7 BT.
- A 10" ponderosa pine bears N 01°10' W, 44.4 feet, scribed T4S R29E S6 BT.

LOCATION AND COMMENTS: Corner is located on West side of a rocky knob with few trees.

FIRM: William R. Wells, PLS  
P.O. Box 1696  
Pendleton, OR 97801

COMPASS DECLINATION: 18° East Surveyor's Seal

Witnesses: Jason Wells, LSIT  
Mark Hammersla  
V4S29E5

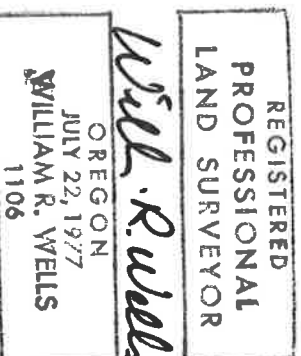

RECEIVED BY

Morrow County Surveyor  
Date 01/21/02  
Rec'd By RWM  
No. C-1321-M