

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

INDEX No. N-11

History of original corner establishment:

DIAGRAM

This corner was originally established by Edward W. Sanderson in 1881-82 under GLO Contract Number 417. Surveyor General

T55 R27E

S16

1/4 _____

Notes state:

S21

Set sandstone 18x10x7 ins. 12 ins. in ground for 1/4 sec. cor. marked 1/4 on N face from which

1992

PLS 848

A Pine 8 in. dia. bears S30°E, 18 lks. dist. marked 1/4 S BT
A Pine 14 in. dia. bears N25°E, 37 lks. dist. marked 1/4 S BT

Description of Corner Evidence Found:

Found original stone, marked 1/4, wired to fence. I was unable to determine where it had been originally set.

Ponderosa Pine, 28" dia, with scribes visible on upper blaze, lower blaze healed, bears N30°37'E, 24.45 feet (Rec: N25°E, 24.42 ft.)

Ponderosa Pine, 12" dia., windfall with previously opened upper blaze with scribing visible, bears S84°64'E, 9.63 feet (Rec: S30°E, 11.88 ft) Bearing to root hole.



When comparing the physical location of BT's to the record I found the SE BT record must have been misrecorded as S30°E instead of S80°E.

Description of monument and accessories I established to perpetuate the original location of this corner:

Based on the best fit from the above recovered original bearing trees I set 2-1/2"x30" aluminum pipe with 3-1/2" aluminum cap, stamped as shown on the DIAGRAM, 26" in the ground and buried the original stone along north side of monument. From Which:

Douglas Fir, 16" dia., bears N18°15'E, 39.8 ft., scribed: 1/4 S16 BT
Ponderosa Pine, 20" dia., bears N62°15'E, 45.0 ft., scribed: 1/4 S16 BT
Douglas Fir, 18" dia., bears S13°15'W, 22.6 ft., scribed: 1/4 S21 BT
Douglas Fir, 16" dia., bears S76°00'W, 31.9 ft., scribed: 1/4 S21 BT

Measurements to BT's taken with a magnetic compass, declination 20° East, and a nylon clad steel tape. Set steel fence post with Land Survey Monument (54-9) and Property Boundary (54-2) signs 5' east and west of the monument. Nailed a brass washer stamped PLS 848 on blaze above BT scribe as taken this survey. Nailed Bearing Tree (54-3) signs above blaze and Land Survey Monument (54-9) signs on back of each tree as required. Painted a 6" red band above Bearing Trees signs and painted blaze red.

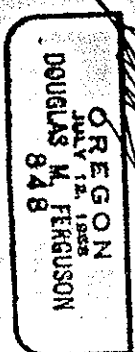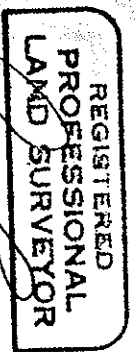

This work was performed by:
Douglas M. Ferguson PLS 848
Witnessed by: D. Mitchell Ferguson
and Rick Sauli
March 27, 1992
Refer to Morrow Co. Survey No.:

Office of _____ County of MORROW
State of OR I hereby certify that the within instrument was
filed in this office for record on the 9 day of July, 1992
by SA
(COUNTY OFFICIAL) (DEPUTY)