

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

L-17

DIAGRAM

T59 R28E  
S151S14  
S151S14

History of original corner establishment:

E.W. Sanderson under G.L.O. contract no. 417, dated Aug. 24, 1881, set a basalt stone 15" x 8" x 5", 10" in the ground, marked  $\frac{1}{4}$  on W. face, from which:  
A Fir, 6" dia., West, 25 lks.  
A Fir, 10" dia., S70°E, 13 lks.

Leonard Carter, Public Land Surveyor, under G.L.O. special instructions, Group No. 228, dated Mar. 23, 1938, found a sandstone 10" x 6" x 4" marked  $\frac{1}{4}$  on W. face. He replaced the orig. stone with a 1" x 3" iron post with a brass cap marked:

He marked new BTs:  
A Douglas Fir, 5" dia., N45 $\frac{1}{2}$ °E, 53 lks.  
A Douglas Fir, 8" dia., S89°W, 45 lks.

S151S14  
 $\frac{1}{4}$   
1938

Description of corner evidence found:

I found a 1" iron pipe with a 2 $\frac{1}{2}$ " brass cap marked:

S151S14  
 $\frac{1}{4}$   
1938

From the corner:  
A Douglas Fir, 8" dia., N45°E, 35.0 ft.; with a healed blaze. Tree is dying.  
A Douglas Fir, 14" dia., S89°W, 30.3 ft.; with a healed blaze.

Description of monument and accessories I established to perpetuate the original location of this corner:

I built a mound of stone around the monument and marked a new BT:  
A Western Larch, 12" dia., N11 $\frac{1}{2}$ °E, 31.3 ft.; marked:  $\frac{1}{4}$  S14 BT

BTs have blaze and a 6" band painted red, BT tags and "Land Survey Monument" signs. New BT has, additionally, an alum. "PLS 1832" washer nailed to the bottom of the blaze. There is a 6' steel fence post with a "Land Survey Monument" sign within 5' of the corner.

Measured to center of BTs using steel tape and staff compass. Magnetic declination set at 20°E.

September 11, 1988


RECEIVED BY

Markom County Surveyor

Date 11/1988

Rec'd By KCHK

No. Q 872K

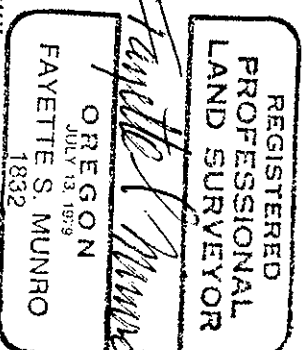

Office of..... County of.....

State of..... I hereby certify that the within instrument was filed in this office  
for record on the..... day of....., 19.....

(COUNTY OFFICIAL) by (DEPUTY)