


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Refer to: Plat of Penland 1988 Cadastral Survey
 Section 22, T.5S., R.28E., W.M.

History of original corner establishment:
 None.

P-16

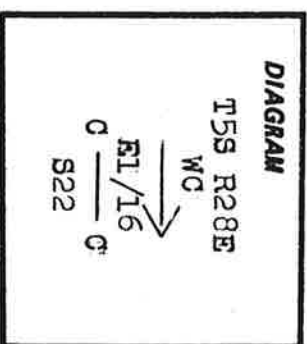

Description of corner evidence found:
 None.

Description of monument and accessories | established to perpetuate the original location of this corner:

I set a 2 1/2" x 30" alum. pipe with a 2 1/2" alum. cap containing a magnet and marked:

Monument is S89° 03' 12"W, 23.06 ft. from
 C-E1/16 corner, which falls below the high water
 line of Penland Lake.
 Monument is 22" in the ground and surrounded
 by a mound of stone.
 From the monument:
 A White Flr, 12" dia., S74 1/2°W, 20.6 ft.; marked X at breast height
 and BT at base.
 A Lodgepole Pine, 10" dia., N25°W, 19.3 ft.; marked X at breast height
 and BT at base.

BTs have blaze and a 6" band painted red, BT tags, "Land Survey Monument" signs and alum. "PLS 1832" washers nailed to the bottom of the blaze. There is a 6' steel fence-post with a "Land Survey Monument" sign within 5' of the monument.

Measured to center of BTs using steel tape and staff compass. Magnetic declination set at 18 1/2°E.
 September 1, 1988

Office of Surveyor County of Marion
 State of Or. I hereby certify that the within instrument was filed in this office
 for record on the day of Nov., 1988 by David H. Reeves
 (COUNTY OFFICIAL)

**REGISTERED
 PROFESSIONAL
 LAND SURVEYOR**

Temple P. Munro

OREGON
 JUL 7 13 1979
FAYETTE S. MUNRO
 1832

RECEIVED BY

Morrow County Surveyor
 Date 11/88
 Rec'd By DAK
 No. D 8741